

# W & A

## PARTS MANUAL



## RICE LEVEE SEEDERS

Model No. 894 -- 8 Foot

Model No. 898 -- 12 Foot



*Quality Products from*

**W & A MANUFACTURING COMPANY**

P.O. Box 5238, Pine Bluff, Arkansas 71611

Phone: (870) 534-7420


Fax: (800) 336-1318

Website: [www.wamfgco.com](http://www.wamfgco.com)

0894 & 0898 - 03/16

# LEVEE SEEDERS


Model 894 (8 Ft.) and Model 898 (12 Ft.)

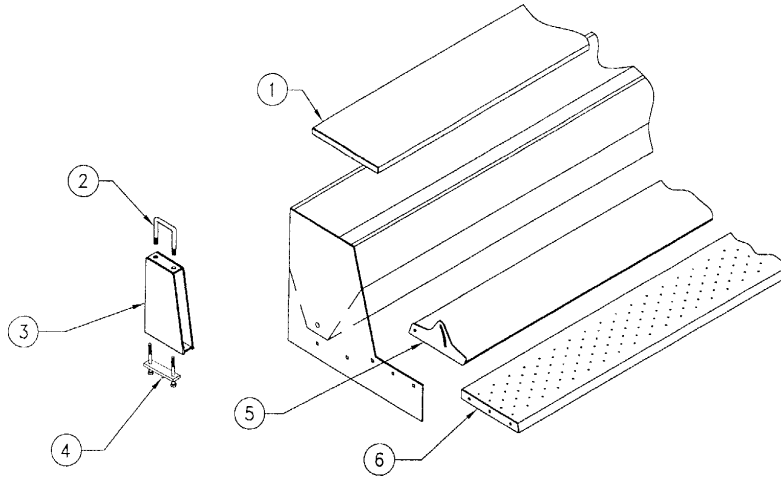

Item No.	Part No.	Wt. Lbs.	Description	Qty. Req'd	
				8'	12'
1	800954	61	Lid (8 ft. Seeder) .....	1	-
-	800956	82	Lid (12 ft. Seeder) .....	-	1
-	805179	2	Inside Latch / Support (Seeder Lid) .....	1	1
-	411545	-	Hex Bolt -- 1/2" x 1 1/2" NC - Gr 5 - Zinc .....	1	1
-	410008	-	Lock Nut -- 1/2" NC - Zinc .....	1	1
-	410093	1/4	Outside Rubber Latch (Seeder Lid) .....	2	2
-	411126	-	Hex Bolt -- 5/16" x 2" NC - Gr 2 - Zinc .....	2	2
-	412005	-	Hex Nut -- 5/16" - 18 - Gr 2 - Zinc .....	2	2
-	413505	-	Lock Washer -- 5/16" - Zinc .....	2	2
2	415008	1 1/2	3/4" Sq. U-Bolt x 4" x 5 1/4" Leg .....	2	4
-	413512	-	Lock Washer -- 3/4" - Zinc .....	4	8
-	412012	-	Hex Nut -- 3/4" - 10 - Gr 2 - Zinc .....	4	8
3	800968	22 1/2	Spacer Block (8 Ft. & 12 Ft. Seeders) .....	2	4
4	201204	1 3/4	Backing Plate (Seeder) .....	2	4
-	411571	1/2	Hex Bolt -- 5/8" x 6" NC - Gr. 5 - Zinc .....	4	8
-	412010	-	Hex Nut -- 5/8" - 11 - Gr 2 - Zinc .....	4	8
-	413510	-	Lock Washer -- 5/8" - Zinc .....	4	8
5	800962	44 1/2	Seed Pan (8 ft. Seeder) .....	1	-
-	800964	72 1/2	Seed Pan (12 ft. Seeder) .....	-	1
-	805181	-	Pan Spacer .....	4	4
-	411735	-	Carriage Bolt -- 1/2" x 2 1/2" NC - Gr 2 - Zinc .....	4	4
-	413008	-	Flat Washer -- 1/2" - Zinc .....	4	4
-	410008	-	Lock Nut -- 1/2" NC - Zinc .....	4	4
6	800958	30	Walkboard (8 ft. Seeder) .....	1	-
-	800960	50	Walkboard (12 ft. Seeder) .....	-	1
-	411729	-	Carriage Bolt -- 1/2" x 1 1/4" NC - Gr 2 - Zinc .....	6	6
-	412008	-	Hex Nut -- 1/2" - 13 - Gr 2 - Zinc .....	6	6
-	413508	-	Lock Washer -- 1/2" - Zinc .....	6	6

# LEVEE SEEDERS


Model 894 (8 Ft.) and Model 898 (12 Ft.)

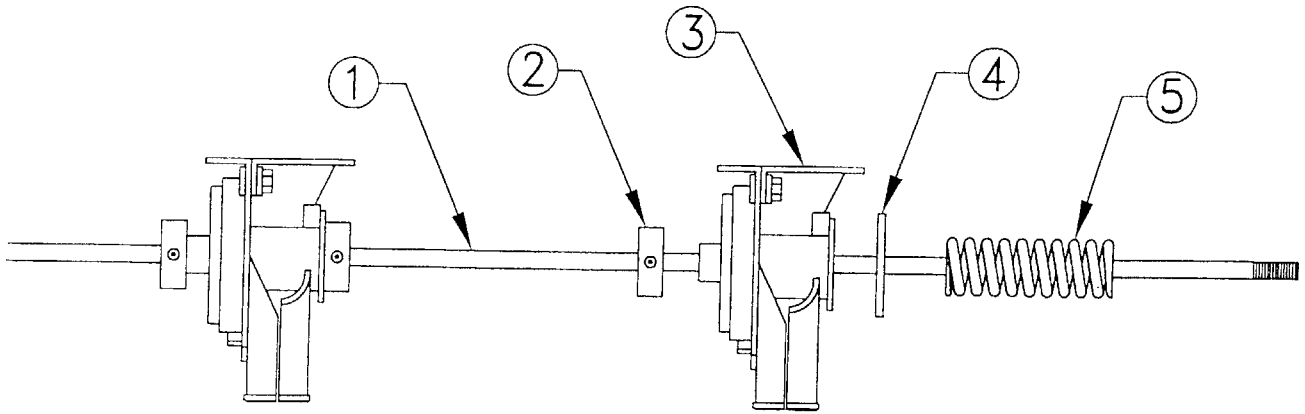

Item No.	Part No.	Wt. Lbs.	Description	Qty. Req'd	
				8'	12'
1	805193	10¾	5/8" Square Shaft x 98½"..... (For 8 Ft.) .....	1	-
-	805194	16	5/8" Square Shaft x 146½" .....(For 12 Ft.) .....	-	1
2	400015	-	15/16" Lock Collar w/Set Screw - Seeder .....	15	23
3	407080	½	Seed Cup Assembly - Seeder .....	8	12
-	410060	-	Self-Tap Bolt -- 1/4" x 5/8" .....	32	48
4	413014	-	Flat Washer -- 7/8" - Zinc .....	1	1
5	471085	¼	Compression Spring -- 3/16" x 1-1/16" x 3½" .....	1	1




# SEEDER DRIVE

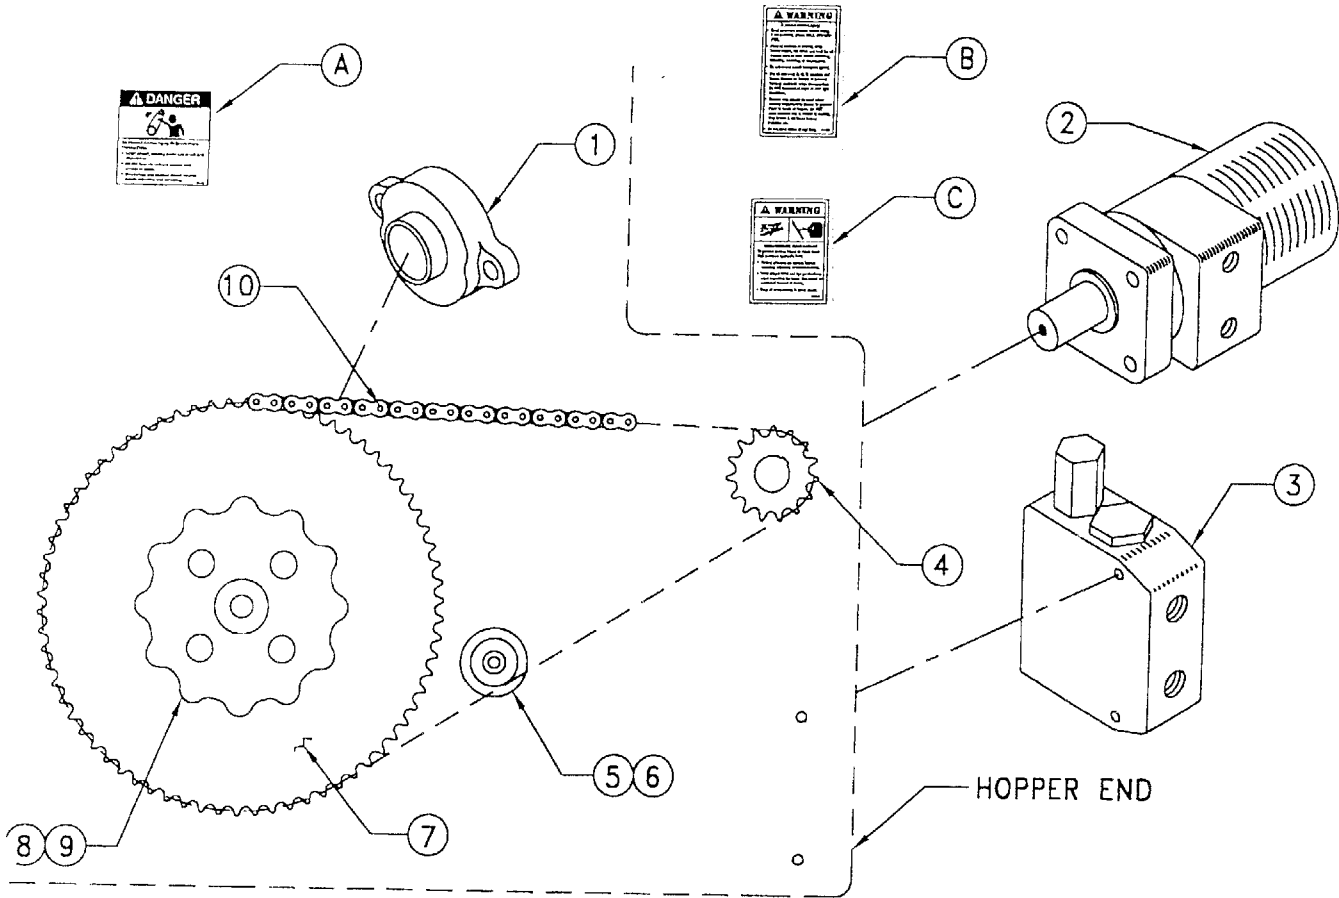


Item No.	Part No.	Wt. Lbs.	Description	Qty. Req'd	
				8'	12'
1	482022	1¼	1¼" Levee Seeder Bearing Assembly .....	1	1
-	411143	-	Hex Bolt -- 3/8" x 1¼" NC - Gr 2 - Zinc .....	2	2
-	412006	-	Hex Nut -- 3/8" - 16 - Gr 2 - Zinc .....	2	2
-	413506	-	Lock Washer -- 3/8" - Zinc .....	2	2
2	425005	18½	Hydraulic Motor 14.6 Cu. In. (Seeder) .....	1	1
-	411506	-	Hex Bolt -- 3/8" x 1" - Gr 5 - Zinc .....	4	4
-	413506	-	Lock Washer -- 3/8" - Zinc (No Nut) .....	4	4
-	425025	-	Seal Kit - Serial Numbers up to 6751 (Prince) .....	-	-
-	425026	-	Seal Kit - Serial Numbers 6752 and up (Danfoss) ...	-	-
3	400188	8	Adjustable Flow Control (Seeder) .....	1	1
-	411116	-	Hex Bolt -- 1/4" x 2¾" NC - Gr 5 - Zinc .....	2	2
-	412004	-	Hex Nut -- 1/4" - 20 - Gr 2 - Zinc .....	2	2
-	413504	-	Lock Washer -- 1/4" .....	2	2
-	413004	-	Flat Washer -- 1/4" .....	2	2

# MOTOR AND FLOW CONTROL PLUMBING

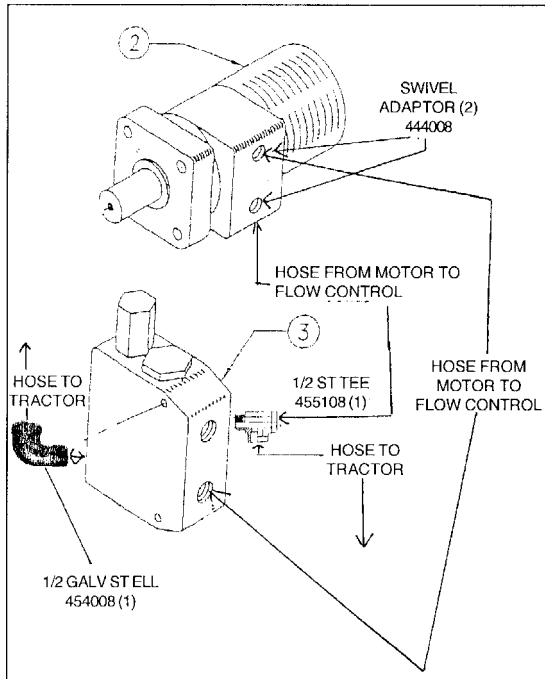


Item No.	Part No.	Wt. Lbs.	Description	Qty. Req'd	
				8'	12'
4	403021	3/4	15 Tooth Sprocket (Seeder) .....	1	1
5	403003	-	Plastic Idler (Seeder) .....	1	1
6	401036	-	Idler Bushing (Seeder) .....	1	1
-	411717	-	Carriage Bolt -- 3/8" x 3" NC - Gr 2 - Zinc .....	1	1
-	412006	-	Hex Nut -- 3/8" - 16 - Gr 2 - Zinc .....	1	1
-	413506	-	Lock Washer -- 3/8" - Zinc .....	1	1
-	413006	-	Flat Washer -- 3/8" - Zinc .....	1	1
7	403026	8	70 Tooth Sprocket (Seeder) .....	1	1
8	805188	2	Adjusting Wheel (Seeder) .....	1	1
-	412010	-	Hex Nut -- 5/8" - 11 - Gr 2 - Zinc .....	1	1
9	805183	-	Wheel Spacer (Seeder) .....	1	1
10	402040	1 1/2	#40 Roller Chain x 49 Links (Seeder) .....	1	1
-	402041	-	Connector Link No. 40 Roller Chain .....	1	1

# SEEDER DRIVE (Continued)

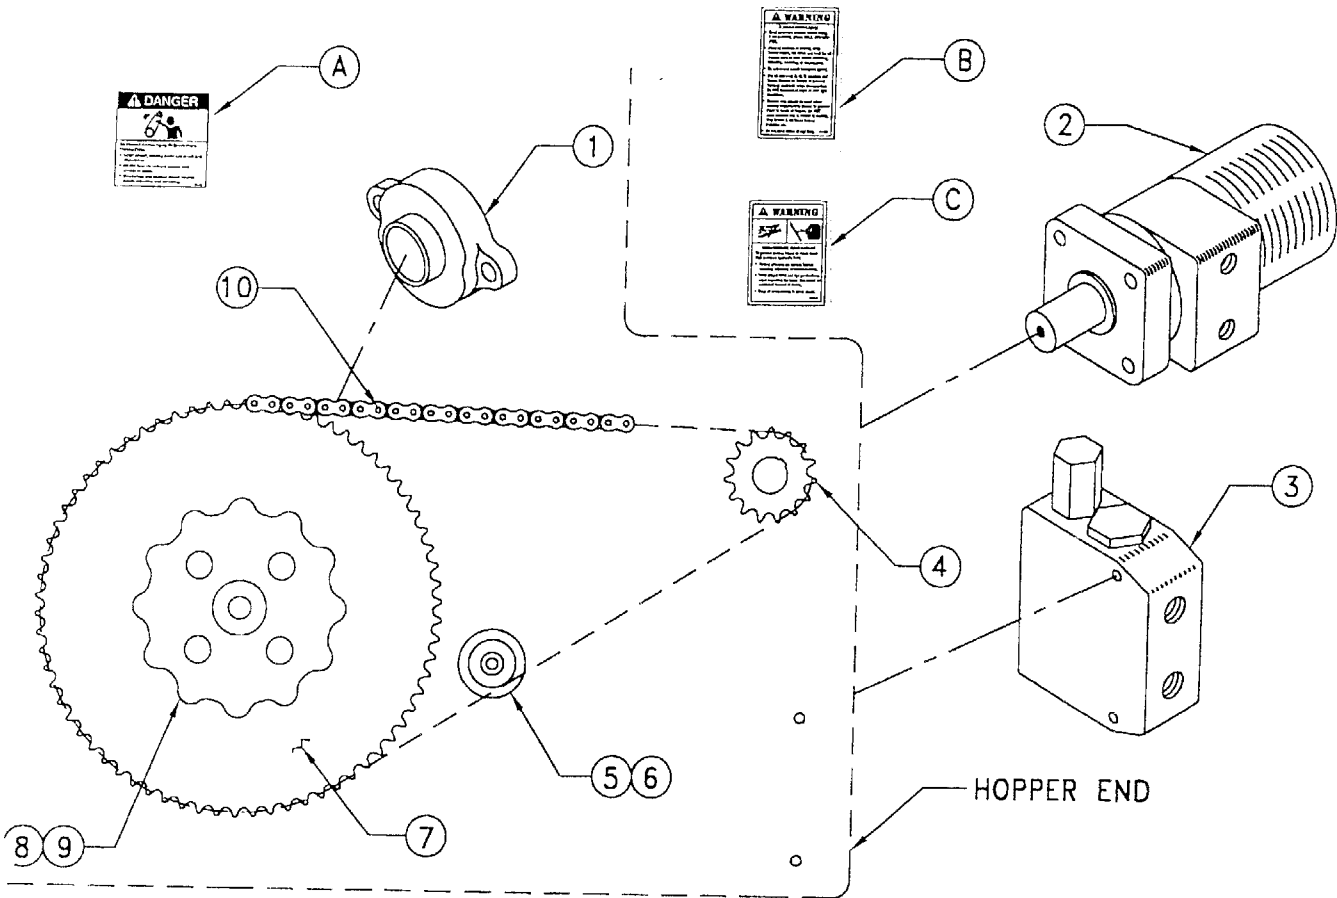

Item No.	Part No.	Wt. Lbs.	Description	Qty. Req'd	
				8'	12'
N/I	800866	7½	Chain Guard .....	1	1
-	411142	-	Hex Bolt -- 3/8" x 1" NC - Gr 5 - Zinc .....	3	3
-	412006	-	Hex Nut -- 3/8" - 16 - Gr 2 - Zinc .....	3	3
-	413506	-	Lock Washer -- 3/8" - Zinc .....	3	3
N/I	457230	-	Hyd Hose Quick Connector #8010-4P .....	2	2

# SAFETY SIGNS

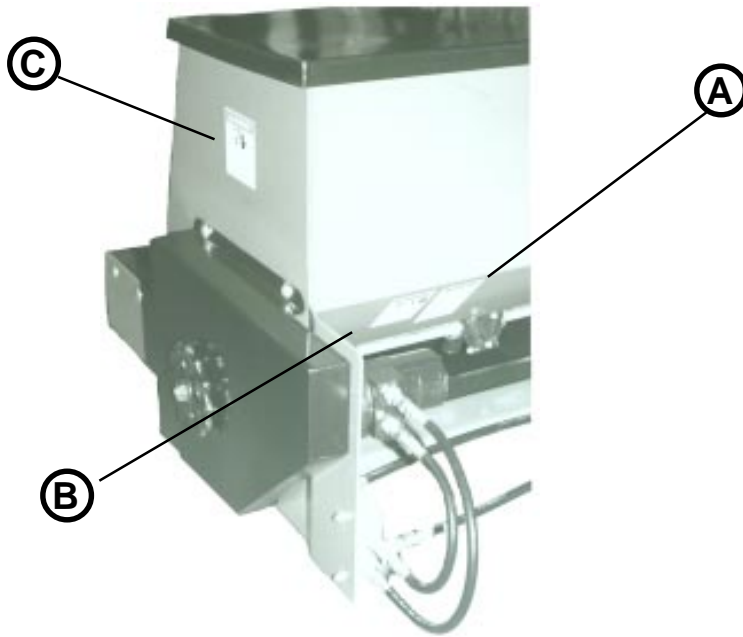

A. 461137 Danger Decal --  
READ OPERATOR'S MANUAL



B. 461113 Warning Decal --  
HIGH PRESSURE FLUID



C. 461139 Danger Decal --  
MOVING PARTS

**USE ONLY**

**W & A REPLACEMENT PARTS**



## **W & A Manufacturing Company**

**1810 Ohio Street  
Phone (870) 534-7420**

**P.O. Box 5238  
Fax (800) 336-1318**

**PINE BLUFF, ARKANSAS 71611**

***www.wamfgco.com***